



MJN Home Inspections, Inc.

Mahopac, NY 10541

(914) 629-0769

www.mjnhicom

michal@mjnhicom

Inspected By: Michal Nowak



Home Inspection Report

Prepared For:

Demo Dan

Property Address:

123 Example Ln

Inspected on Tue, Mar 16 2021 at 9:53 PM

Table of Contents

General	4
Site	4
Exterior	5
Garage	7
Roofing	9
Structure	12
Electrical	15
HVAC	16
HVAC #2	19
Plumbing	22
Bathrooms	25
Kitchen	29
Laundry	32
Interior	33
Report Summary	34

Thank you for the opportunity to conduct a home inspection of the property listed above. We understand that the function of this report is to assist you in understanding the condition of the property to assist in making an informed purchase decision.

The report contains a review of components in the following basic categories: site, exterior, roofing, structure, electrical, HVAC, plumbing, and interior. Additional categories may or may not be included. The report is designed to be easy to read and comprehend however it is important to read the entire report to obtain a full understanding of the scope, limitations and exclusions of the inspection.

In addition to the checklist items of the report there are several comments which are meant to help you further understand certain conditions observed. These are easy to find by looking for their icons along the left side margin. Comments with the blue icon are primarily informational and comments with the orange icon are also displayed on the summary. Please read them all.

DEFINITION OF CONDITION TERMS

Satisfactory: At the time of inspection the component is functional without observed signs of a substantial defect.

Marginal: At the time of inspection the component is functioning but is estimated to be nearing end of useful life. Operational maintenance recommended. Replacement anticipated.

Repair or Replace: At the time of inspection the component does not function as intended or presents a Safety Hazard. Repair or replacement is recommended.

Further Evaluation: The component requires further technical or invasive evaluation by qualified professional tradesman or service technician to determine the nature of any potential defect, the corrective action and any associated cost.

General

Client's Signature:



Property Type:	Single Family
Stories:	Two
Approximate Age:	5 Years
Age Based On:	Electrical Inspection
Bedrooms/Baths:	4/3
Door Faces:	Southeast
Furnished:	Yes
Occupied:	No
Weather:	Sunny
Temperature:	Warm
Soil Condition:	Dry
Utilities On During Inspection:	Electric Service, Gas Service, Water Service
People Present:	Client

Site

The condition of the vegetation, grading, surface drainage and retaining walls that are likely to adversely affect the building is inspected visually as well as adjacent walkways, patios and driveways.

Site Grading:	Sloped Away From Structure Condition: Satisfactory
Vegetation:	Generally Maintained Condition: Satisfactory
Retaining Walls:	Not Present
Driveway:	Concrete Condition: Satisfactory
Walkways:	Concrete Condition: Satisfactory
Steps/Stoops:	Concrete Condition: Satisfactory
Patios/Decks:	Concrete Condition: Satisfactory

(Site continued)

i Comment 1:
 Patio and pergola are in acceptable condition. Keep pergola maintained.



Figure 1-1

Exterior

The visible condition of exterior coverings, trim and entrances are inspected with respect to their effect on the condition of the building.

Exterior Covering:	Brick Condition: Satisfactory
Exterior Trim Material:	Vinyl, Aluminum Condition: Satisfactory
Windows:	Metal Clad Condition: Satisfactory
Entry Doors:	Wood, Fiberglass, Steel Condition: Satisfactory
Balconies:	Not Present
Railings:	Wood Condition: Marginal

(Exterior continued)



Comment 2:

Several areas of gaps in exterior trim. Have caulked and painted to protect from weather.



Figure 2-1



Figure 2-2



Comment 3:

There are hairline brick cracks above rear roof. This is not a structural issue. Monitor and repair by tuck pointing if needed.



Figure 3-1



Figure 3-2

(Exterior continued)



Comment 4:
Screen porch is in acceptable condition. Ok.



Figure 4-1



Figure 4-2

Garage

Garage Type:	Attached
	Condition: Satisfactory
Garage Size:	2 Car
Door Opener:	Chain Drive
	Condition: Satisfactory
Opener Safety Feature:	Light Beam, Force Sensitive
	Condition: Satisfactory

(Garage continued)



Comment 5:
Vehicle door and opener operates as expected.



Figure 5-1



Comment 6:
Steps in garage are missing handrail & guardrail. Install for safety.



Figure 6-1

Roofing

The visible condition of the roof covering, flashings, skylights, chimneys and roof penetrations are inspected. The purpose of the inspection is to determine general condition, NOT to determine life expectancy.

Inspection Method:	From Ground with Binoculars
Roof Design:	Gable
Roof Covering:	3 Tab Shingle, Metal
	Condition: Satisfactory
Approximate Roof Age:	5-10 Years
Ventilation Present:	Not Present
Vent Stacks:	Metal
	Condition: Satisfactory
Chimney :	Wood Frame
	Condition: Satisfactory
Sky Lights:	Not Present
Flashings:	Metal
	Condition: Satisfactory
Soffit and Fascia:	Wood
	Condition: Satisfactory
Gutters & Downspouts:	Metal
	Condition: Satisfactory



Comment 7:

Prior repairs to rear right soffit. Have owner explain when and why repairs were made. Monitor.

(Roofing continued)



Figure 7-1



Figure 7-2



Comment 8:

Visible roofing and gutters are in acceptable condition unless otherwise noted.



Figure 8-1

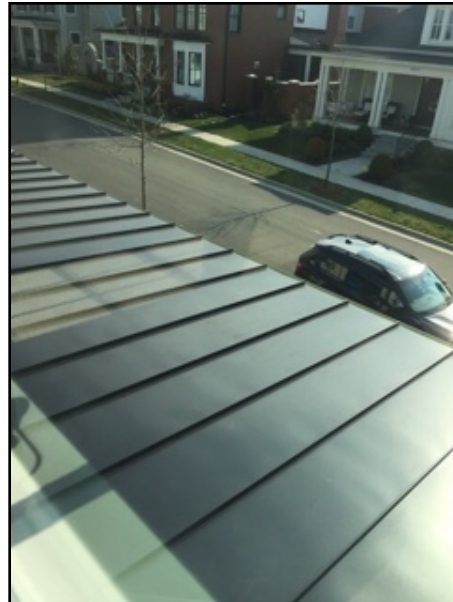


Figure 8-2

(Roofing continued)



Figure 8-3



Figure 8-4



Comment 9:
Chimney is in acceptable condition. Ok.



Figure 9-1

(Roofing continued)

i Comment 10:
Rear garage downspout washing out soil. Install splash block and monitor.



Figure 10-1

Structure

The visible condition of the structural components is inspected. The determination of adequacy of structural components is beyond the scope of a home inspection.

Foundation Types:	Basement
Foundation Material:	Poured Concrete
	Condition: Satisfactory
Signs of Water Penetration:	Not Present
Prior Waterproofing:	Not Present
Floor Structure:	Wood Frame
	Condition: Satisfactory
Subflooring:	Plywood
	Condition: Satisfactory
Wall Structure:	Full Masonry
	Condition: Satisfactory

(Structure continued)



Comment 11:

Majority of basement is finished with paneling, drywall and/or carpet. Very little of foundation is visible to inspect.



Figure 11-1



Figure 11-2

Attic

Attic Entry:	Bedroom Closet
Roof Framing Type:	Not Present
Roof Deck Material:	Not Inspected
Vent Risers:	PVC
	Condition: Satisfactory
Insulation:	Spray Foam
	Condition: Satisfactory



Comment 12:

View inside attic. Ok. Most of roof structure was covered with insulation and was not visible.

(Attic continued)



Figure 12-1



Figure 12-2



Figure 12-3

Crawlspace

If the clearance from the ground to the bottom of the joists is less than 36", or other adverse conditions exist, the inspector is not obligated to enter the crawl space.

Inspection Method:	Not Inspected
Vapor Retarder:	Not Inspected
Underfloor Insulation:	Not Inspected
Ventilation Present:	Not Inspected
Moisture Condition:	Not Inspected

(Crawlspace continued)

**Comment 13:**

Portions of the crawlspace were not inspected. Crawl space was not accessible the day of inspection as door was locked. Recommend future inspection once access is gained

Electrical

The inspector can not inspect hidden wiring or verify if the number of outlets is per the National Electric Code. A representative number of outlets, switches and fixtures are tested for operation.

Type of Service:	Underground
Main Disconnect Location:	Service Panel
Service Panel Location:	Basement
Service Line Material:	Aluminum
	Condition: Satisfactory
Service Voltage:	240 volts
Service Amperage:	200 amps
Service Panel Ground:	Cold Water Pipe, Ground Rod
Branch Circuit Wiring:	Non-Metallic Shielded Copper
	Condition: Satisfactory
Overcurrent Protection:	Breakers
	Condition: Satisfactory
GFCI/AFCI Breakers:	Yes
	Condition: Satisfactory
Smoke Detectors:	Hard Wired Interconnected
	Condition: Satisfactory

(Electrical continued)



Comment 14:
Inside electrical panel. Ok

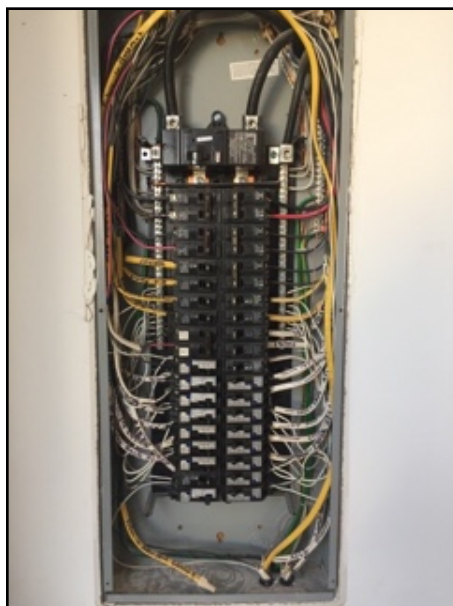


Figure 14-1

Sub Panel

Location:

Service Line Material:

Overcurrent Protection:

Branch Circuit Wiring:

GFCI/AFCI Breakers:

HVAC

HVAC System Type:

Central Split System

(HVAC continued)

Heating

The heating system is inspected visually and operated by normal controls to determine general condition NOT life expectancy. The capacity or adequacy of the heating system is beyond the scope of a home inspection. A licensed HVAC contractor should be consulted if in question.

Location:	Basement
Type of Equipment:	Forced Air
	Condition: Satisfactory
Manufacturer:	Carrier
Heating Fuel:	Gas
	Condition: Satisfactory
Input BTUs:	80,000
Output BTUs:	78,000
Approximate Age:	3 Years
Filter Type:	Disposable
	Condition: Satisfactory
Output Temperature:	80
Type of Distribution:	Metal Ducting, Flexible Ducting
	Condition: Satisfactory

(Heating continued)



Comment 15:
Furnace and data plate. Operates as expected.



Figure 15-1



Figure 15-2

Furnaces over 10 years old should be checked, cleaned and serviced yearly by a licensed contractor.

Cooling

The cooling system is inspected by operation of the equipment by normal controls to determine general condition NOT life expectancy. The capacity or adequacy of cooling system is beyond the scope of a home inspection. A licensed HVAC contractor should be consulted if in question.

- | | |
|---------------------------------|-------------------------|
| Energy Source: | Electric |
| Type of Equipment: | Split System |
| | Condition: Satisfactory |
| Condenser Make: | Carrier |
| Condensor Size: | 36,000 BTU (3 Tons) |
| Condenser Approximate Age: | 3 Years |
| Expansion Coil Make: | Carrier |
| Expansion Coil Size: | 36,000 BTU (3 Tons) |
| Expansion Coil Approximate Age: | 3 Years |

(Cooling continued)

Condensate Drainage:	To Floor Drain
	Condition: Satisfactory
AC Supply Air Temp:	75° F
AC Return Air Temp:	55° F
AC Temperature Drop:	20° F



Comment 16:
AC unit and data plate for basement unit. Operates as expected.



Figure 16-1



Figure 16-2

Air conditioners over 10 years old and heat pumps over 5 years old should be checked, cleaned and serviced yearly by a licensed contractor.

HVAC #2

HVAC System Type: Central Split System

(HVAC #2 continued)

Heating

The heating system is inspected visually and operated by normal controls to determine general condition NOT life expectancy. The capacity or adequacy of the heating system is beyond the scope of a home inspection. A licensed HVAC contractor should be consulted if in question.

Location:	Attic
Type of Equipment:	Heat Pump
	Condition: Satisfactory
Manufacturer:	Carrier
Heating Fuel:	Electric
	Condition: Satisfactory
Approximate Age:	3 Years
Filter Type:	Disposable
	Condition: Satisfactory
Output Temperature:	120° F
Type of Distribution:	Metal Ducting, Flexible Ducting
	Condition: Satisfactory

(Heating continued)

**Comment 17:**

Heat pump and data plate. Operates as expected.



Figure 17-1



Figure 17-2

Furnaces over 10 years old should be checked, cleaned and serviced yearly by a licensed contractor.

Cooling

The cooling system is inspected by operation of the equipment by normal controls to determine general condition NOT life expectancy. The capacity or adequacy of cooling system is beyond the scope of a home inspection. A licensed HVAC contractor should be consulted if in question.

Energy Source:	Electric
Type of Equipment:	Split System
	Condition: Satisfactory
Condenser Make:	Carrier
Condensor Size:	30,000 BTU (2.5 Tons)
Condenser Approximate Age:	3 Years
Expansion Coil Make:	Carrier
Expansion Coil Size:	30,000 BTU (2.5 Tons)
Expansion Coil Approximate Age:	3 Years
Condensate Drainage:	To Floor Drain
	Condition: Satisfactory
AC Supply Air Temp:	75° F
AC Return Air Temp:	55° F

(Cooling continued)

AC Temperature Drop:

20° F



Comment 18:

Heat pump and data plate for second floor. Operates as expected.



Figure 18-1

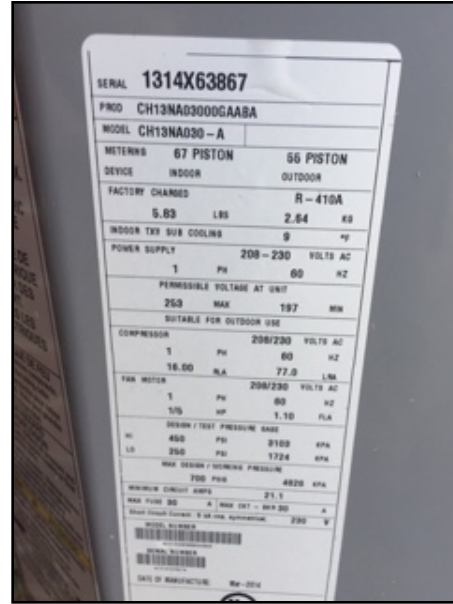


Figure 18-2

Air conditioners over 10 years old and heat pumps over 5 years old should be checked, cleaned and serviced yearly by a licensed contractor.

Plumbing

The plumbing system is inspected visually and by operating a representative number of fixtures and drains. Private water and waste systems are beyond the scope of a home inspection.

Water Service:

Public

Supply Pipe Material:

Copper, PEX

Condition: Satisfactory

Location of Main Water Shutoff:

Basement

Sewer System:

Public

Waste Pipe Material:

PVC

Condition: Satisfactory

(Plumbing continued)

Sump Pump:

Sealed Crock

Condition: Satisfactory

Location of Fuel Shutoff:

At Meter



Comment 19:

Sealed sump pump is present. Unable to operate in order to inspect.



Figure 19-1

(Plumbing continued)


 Comment 20:
Hot water circulation pump installed. Appears to operate as expected.



Figure 20-1

Water Heater

Manufacturer:	Ruud
Fuel:	Natural Gas
Capacity:	50 gal
Approximate Age:	3 Years
Temp & Pressure Relief Valve:	Present With Blow Off Leg
	Condition: Satisfactory
Fuel Disconnect:	Within Sight of Equipment

(Water Heater continued)



Comment 21:

Water heater and data plate. Operates as expected.



Figure 21-1

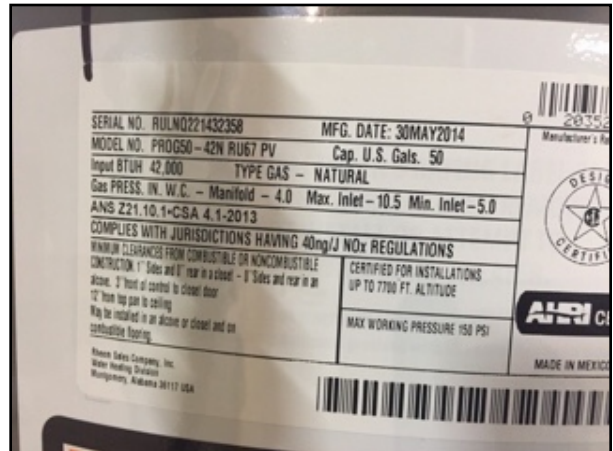


Figure 21-2

Bathrooms

Bathroom #1

Location:	Up Hall
Bath Tub:	Recessed
	Condition: Satisfactory
Shower:	In Tub
	Condition: Satisfactory
Sink(s):	Single Vanity
	Condition: Satisfactory
Toilet:	Standard Tank
	Condition: Satisfactory
Bidet:	Not Present
Shower Walls:	Acrylic
	Condition: Satisfactory

(Bathroom #1 continued)

Floor:	Tile
	Condition: Satisfactory
Ventilation Type:	Ventilator
	Condition: Satisfactory
GFCI Protection:	Outlets
	Condition: Satisfactory



Comment 22:
Hall bath fixtures operate as expected. Ok.



Figure 22-1

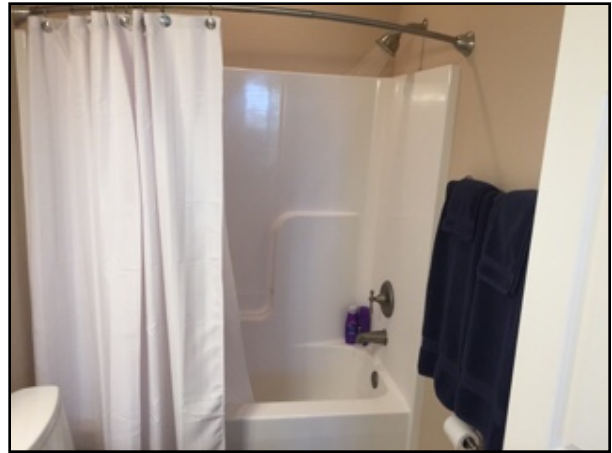


Figure 22-2

Bathroom #2

Location:	1st Half Bath
Sink(s):	Single Vanity
	Condition: Satisfactory
Toilet:	Standard Tank
	Condition: Satisfactory
Bidet:	Not Present
Shower Walls:	Not Present
Tub Surround:	Not Present
Floor:	Tile
	Condition: Satisfactory
Ventilation Type:	Ventilator
	Condition: Satisfactory

(Bathroom #2 continued)

GFCI Protection:

Outlets

Condition: Satisfactory



Comment 23:

Half bath fixtures operate as expected. Ok.



Figure 23-1

Bathroom #3

Location:

Master

Bath Tub:

Recirculating

Condition: Satisfactory

Shower:

Stall

Condition: Satisfactory

Sink(s):

Double Vanity

Condition: Satisfactory

Toilet:

Standard Tank

Condition: Satisfactory

Bidet:

Not Present

Shower Walls:

Tile

Condition: Satisfactory

Tub Surround:

Tile

Condition: Satisfactory

Floor:

Tile

Condition: Satisfactory

(Bathroom #3 continued)

Ventilation Type:

Ventilator

Condition: Satisfactory

GFCI Protection:

Outlets, Lights

Condition: Satisfactory



Comment 24:

Master bath fixtures operate as expected. Ok.



Figure 24-1

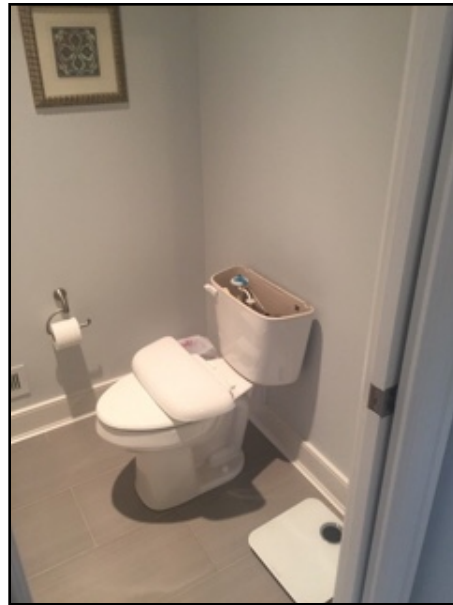


Figure 24-2



Figure 24-3

(Bathroom #3 continued)

- i** Comment 25:
Whirlpool tub operates as expected. Fill and run with 2 cups of bleach for 15 minutes to clean and then refill with plain water and run to rinse.



Figure 25-1

Kitchen

Cabinets:	Wood Condition: Satisfactory
Countertops:	Granite Condition: Satisfactory
Sink:	Double Condition: Satisfactory

Appliances

This is a cursory check only of the specified appliances. The accuracy or operation of timers, temperature or power level controls is beyond the scope of this inspection.

Oven:	Frigidaire Condition: Satisfactory
Cooktop:	Frigidaire Condition: Satisfactory
Range Hood:	General Electric Condition: Satisfactory

(Appliances continued)

Refrigerator:	Sub-Zero Condition: Satisfactory
Dishwasher:	Bosch Condition: Marginal
Microwave:	Frigidaire Condition: Satisfactory
Disposal:	General Electric Condition: Satisfactory



Comment 26:
Appliances operate as expected except as otherwise noted. Ok.



Figure 26-1



Figure 26-2

(Appliances continued)



Figure 26-3



Comment 27:

Dishwasher is not secured to counter. Have fully installed, leveled and operation verified before closing.



Figure 27-1

Laundry

Built In Cabinets:	Yes Condition: Satisfactory
Laundry Sink:	Yes Condition: Satisfactory
Dryer Venting:	To Exterior Condition: Satisfactory
GFCI Protection:	Yes Condition: Satisfactory
Laundry Hook Ups:	Yes Condition: Satisfactory
Washer:	General Electric Condition: Satisfactory
Dryer:	General Electric Condition: Satisfactory



Comment 28:
Laundry sink operates as expected.



Figure 28-1

Interior

The interior inspection is limited to readily accessible areas that are not concealed by furnishings or stored items. A representative number of windows and doors.

Floors:	Carpet, Wood Condition: Satisfactory
Walls:	Painted Drywall Condition: Satisfactory
Window Types:	Double Hung Condition: Satisfactory
Window Materials:	Metal clad
Entry Door Types:	Sliding, Hinged Condition: Satisfactory
Entry Door Materials:	Wood, Metal Clad
Interior Door Materials:	Masonite
Fireplace:	Manufactured Condition: Satisfactory



Comment 29:

Wood burning fireplace is in acceptable condition. Ok. Have cleaned yearly by chimney sweep if used.



Figure 29-1

Report Summary

This summary page is not the entire report. The complete report may include additional information of interest or concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your real estate agent or an attorney.

Exterior

1) Several areas of gaps in exterior trim. Have caulked and painted to protect from weather.



Figure 2-1



Figure 2-2

(Report Summary continued)

Garage

2) Steps in garage are missing handrail & guardrail. Install for safety.



Figure 6-1

Roofing

3) Prior repairs to rear right soffit. Have owner explain when and why repairs were made. Monitor.



Figure 7-1



Figure 7-2

(Report Summary continued)

Structure: Crawlspace

4) Portions of the crawlspace were not inspected. Crawl space was not accessible the day of inspection as door was locked. Recommend future inspection once access is gained

Kitchen: Appliances

5) Dishwasher is not secured to counter. Have fully installed, leveled and operation verified before closing.



Figure 27-1